

Subject: SunDome Module Shim

Number: SRV0015


Applicability: SunDome XL48
Sunvision Elite 48V
SunDome 548V
SolarSystem 48 VIP
SolarSystem 48 Platinum

Date: 10/24/2005

Symptoms: Booth doors are rubbing the front of the pedestal even though the doors have been shimmed at the hinge pins.

Explanation: The pedestal has been determined to be “out of spec” according to our Engineering prints.

Solution: Use a ¼” thick shim under the hinge plates on both sides of the booth (see photos below). This will raise the front of the modules and doors enough to clear the pedestal. A service kit is available from ETS, Inc., which includes two shims and an instruction sheet, if needed.

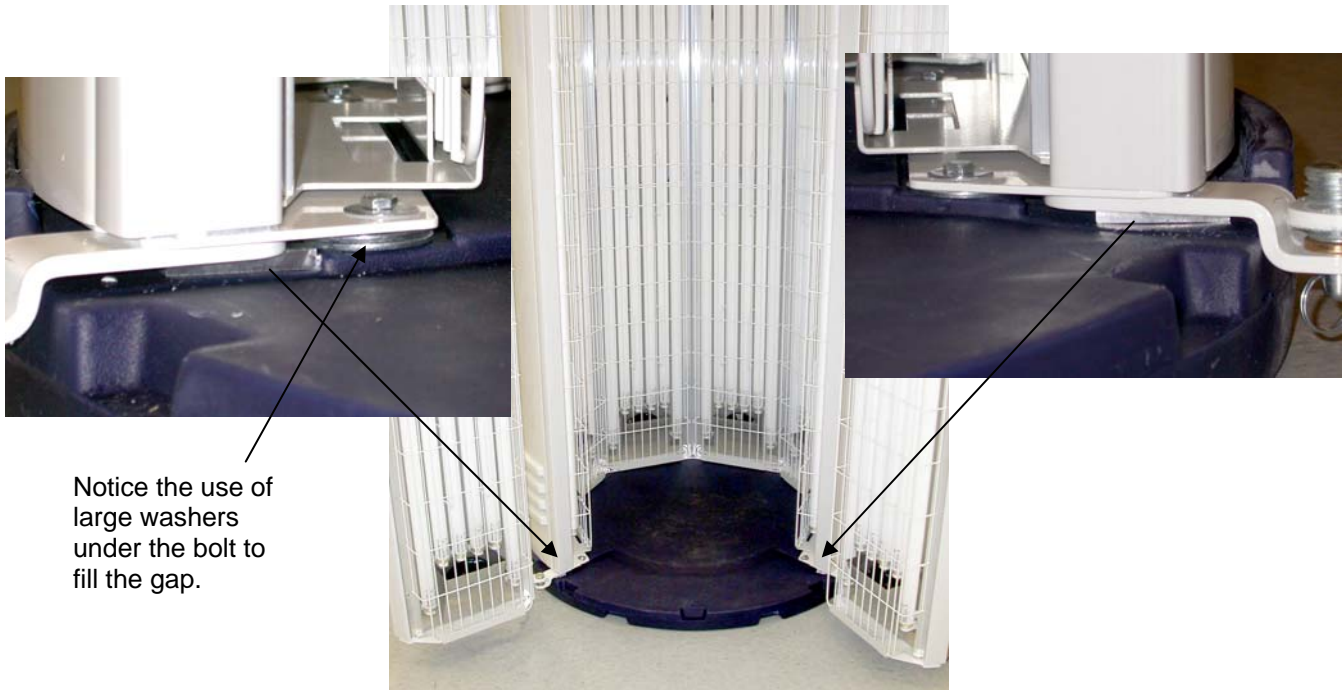

Notice the use of large washers under the bolt to fill the gap.

NOTICE: This document and the information disclosed herein are proprietary data of ETS, Inc. Neither this document nor the information contained herein shall be used, reproduced, or disclosed to others without the written authorization of ETS, Inc. except to the extent required for installation or maintenance of the recipient's equipment.

CAUTION: ETS, Inc. Service Bulletins are intended for use by experienced service technicians. They are written to inform those technicians of conditions that may occur in some equipment, or to provide information that could assist in the proper servicing of the equipment. If a condition is described, DO NOT assume that this service bulletin applies to your equipment, or that your equipment will develop that condition. Always consult your ETS, Inc. Service Technician before performing any modifications to your equipment. When electrical service is needed, we recommend hiring a professional electrician.