

**Subject:** 548 / 52 Too Hot

**Number:** SRV0013

**Applicability:** StarPower 548  
StarPower 52 4F  
52 Platinum


**Date:** 4/19/2005

**Symptoms:** The canopy closes all the way, or very close, to the bench and the tanner is experiencing an extremely hot tanning session.

**Explanation:** The canopy, when fully closed, needs to be about 1" from the bench for proper ventilation during use. Due to manufacturing tolerances, some canopies may close too far to allow the proper ventilation.

**Solution:** A Stop Collar (ETS part number 26943-01, 2 needed per bed) is available to open the gap between the canopy and bench. When slipped over the Travel Limit Pins on the back of the unit (see pictures) the canopy arms hit the Stop Collars, causing the front edge to lift slightly.

To install, remove the chain guards if necessary. Pull out the bridge pin and remove the Travel Limit Pin. Reinsert the Travel Limit Pin into the hinge brackets and Stop Collar. Secure the Travel Limit Pin with the bridge pin. Reinstall the chain guards if necessary.

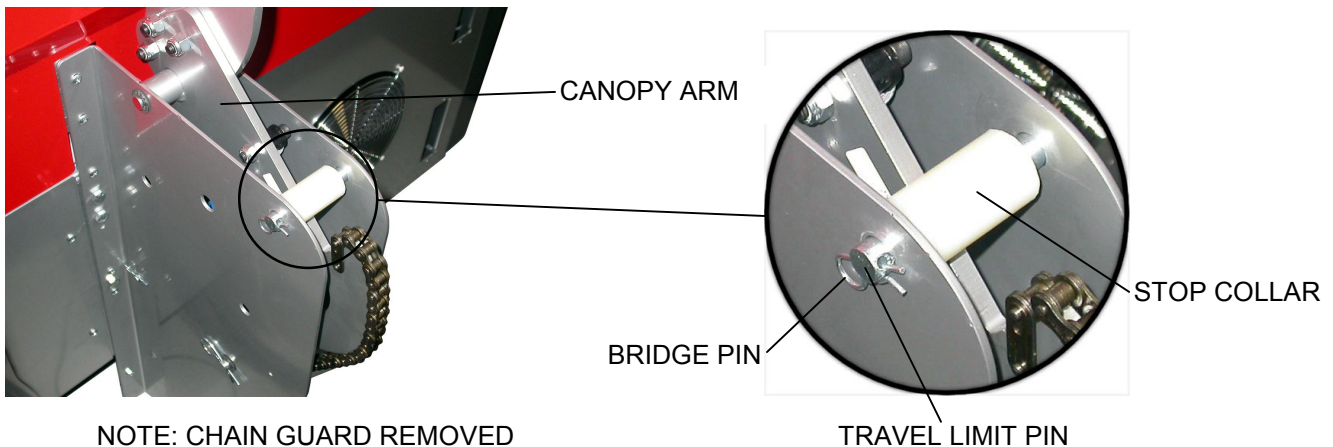

**NOTICE:** This document and the information disclosed herein are proprietary data of ETS, Inc. Neither this document nor the information contained herein shall be used, reproduced, or disclosed to others without the written authorization of ETS, Inc. except to the extent required for installation or maintenance of the recipient's equipment.

**CAUTION:** ETS, Inc. Service Bulletins are intended for use by experienced service technicians. They are written to inform those technicians of conditions that may occur in some equipment, or to provide information that could assist in the proper servicing of the equipment. If a condition is described, DO NOT assume that this service bulletin must be applied to your equipment, or that your equipment will develop that condition. Always consult your ETS, Inc. Technical Service Representative before performing any modifications to your equipment. When electrical service is needed, we recommend hiring a professional electrician.