

Subject: Quench Arc application

Number: SRV0031

Applicability: SS755, 755 ELITE, SolarForce® 648
Any other units exhibiting these symptoms

Date: 01/18/2008

Symptoms: Unit is resetting itself during session


Unit is not displaying clean room indicator; timer automatically clearing clean room indicator

Unit display goes out, unrelated to heat

Explanation: Timers are designed to reset if electronic noise level disrupts timer operations. This can cause the explained symptoms.

Solution: Install *quencharc* (P/N 26676-01) across main contactor(s) coil as described in wiring diagram.

This should alleviate said symptoms.

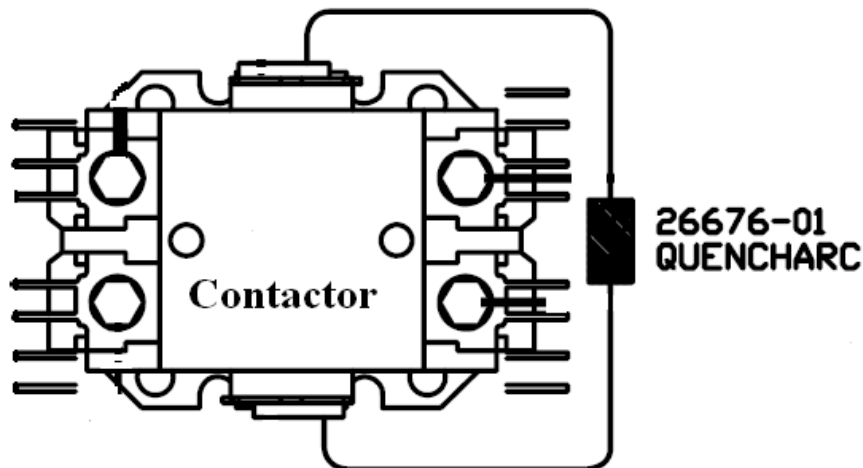

NOTICE: This document and the information disclosed herein are proprietary data of ETS, LLC. Neither this document nor the information contained herein shall be used, reproduced, or disclosed to others without the written authorization of ETS, LLC, except to the extent required for installation or maintenance of the recipient's equipment.

CAUTION: ETS, LLC. Service Bulletins are intended for use by experienced service technicians. They are written to inform those technicians of conditions that may occur in some equipment, or to provide information that could assist in the proper servicing of the equipment. If a condition is described, DO NOT assume that this service bulletin applies to your equipment, or that your equipment will develop that condition. Always consult your ETS, LLC. Service Technician before performing any modifications to your equipment. When electrical service is needed, we recommend hiring a professional electrician.